

# AGF Floor Scale

Software rev: V 1.00 & above



**Easy Reference:**

Model name of the scale:	
Serial number of the unit:	
Software revision number (Displayed when power is first turned on):	
Date of Purchase:	
Name of the supplier and place:	

**CONTENTS**  
**P.N. 1.10.0.0.13103, Rev A, September 2018**

1.0	INTRODUCTION .....	1
2.0	SPECIFICATIONS .....	2
3.0	INSTALLATION .....	4
3.1	LOCATING THE SCALE .....	4
3.2	LIST OF ACCESSORIES .....	4
4.0	KEY DESCRIPTIONS.....	5
5.0	DISPLAYS .....	6
6.0	OPERATION.....	6
6.1	ZEROING THE DISPLAY .....	6
6.2	TARING .....	6
6.3	WEIGHING A SAMPLE .....	7
6.4	CHANGING THE WEIGHING UNITS.....	8
6.5	PRESET TARE .....	8
6.6	PARTS COUNTING.....	8
6.7	CHECK-WEIGHING .....	9
<b>6.7.1</b>	<b>Relay outputs and checkweighing</b> .....	9
6.8	ACCUMULATED TOTAL.....	11
6.10	ANIMAL (Dynamic) WEIGHING .....	12
<b>6.10.1</b>	<b>Animal weighing procedure</b> .....	13
<b>6.11</b>	<b>ANIMAL 2 (DYNAMIC 2) WEIGHING</b> .....	13
<b>6.11.1</b>	<b>Animal 2 weighing procedure</b> .....	14
6.12	HOLD/ PEAK FUNCTION.....	15
7.0	USER PARAMETERS .....	15
7.1	SCALE PARAMETERS .....	16
7.2	RS-232 PARAMETERS .....	17
<b>7.2.1</b>	<b>Print settings</b> .....	17
<b>7.2.2</b>	<b>PC settings</b> .....	18
<b>7.2.3</b>	<b>Command settings</b> .....	19
8.0	BATTERY OPERATION.....	19
9.1	INPUT COMMANDS FORMAT .....	24
10.0	CALIBRATION.....	24
11.0	ERROR CODES .....	25
12.0	REPLACEMENT PARTS AND ACCESSORIES.....	26
13.0	SERVICE INFORMATION.....	26
	WARRANTY STATEMENT .....	27

## 1.0 INTRODUCTION

- The AGF Floor Scale provides the user with the electronics necessary to build an accurate, fast, versatile weighing system.
- Functions include, weighing, check weighing, parts counting, animal weighing and percent weighing.
- The system includes automatic zero tracking, audible alarm for check-weighing, semi-automatic tare and an accumulation facility that allows individual weights or counts to be stored and the total recalled.
- The scales have a bi-directional RS-232 interface for communicating with a PC or printer.
- RS-232 outputs include Real time Clock, English, German, French or Spanish language text and data required for GLP reports.
- The indicator can be used with 1- to 4 load cell platforms.
- Internal rechargeable battery and IP-68 rated enclosure allow for a fully portable and rigged weighing system.







## 2.0 SPECIFICATIONS

<b>AGF Standard Models</b>				
	AGF 150	AGF 300	AGF 600	
Maximum capacity	150kg	300kg	600kg	
Readability	5g	10g	20g	
Resolution	5g	10g	20g	
Repeatability	5g	10g	20g	
Linearity	10g	20g	40g	
<b>AGF US Models (standard)</b>				
	<b>AGF 175a</b>	<b>AGF 350a</b>	<b>AGF 660a</b>	<b>AGF 1320a</b>
Maximum capacity	175lb / 80kg	350lb / 160kg	660lb/ 300kg	1320lb/ 600kg
Readability	0.005lb / 2g	0.01lb / 5g	0.02lb / 10g	0.05lb / 20g
Resolution	0.005lb / 2g	0.01lb / 5g	0.02lb / 10g	0.05lb / 20g
Repeatability	0.005lb / 2g	0.01lb / 5g	0.02lb / 10g	0.05lb / 20g
Linearity	0.01lb / 5g	0.02lb / 10g	0.05lb / 20g	0.1lb / 40g
<b>AGF US Models (Trade Approved)</b>				
	<b>AGF 120aM</b>	<b>AGF 300aM</b>	<b>AGF 600aM</b>	
Maximum capacity	120lb	300lb	600lb	
Readability	0.02lb	0.05lb	0.1lb	
Resolution	0.02lb	0.05lb	0.1lb	
Repeatability	0.02lb	0.05lb	0.1lb	
Linearity	0.04lb	0.1lb	0.2lb	

<b>AGF Trade Approved Models</b>			
	<b>AGF 60M</b>	<b>AGF 150M</b>	<b>AGF 300M</b>
Maximum capacity	60kg	150kg	300kg
Readability	20g	50g	100g
Resolution	20g	50g	100g
Repeatability	20g	50g	100g
Linearity	40g	100g	200g
Pan size	400 x 500mm		AGF 600: 600 x 800mm
Operating temperature	0C-40C		
Power Supply	6V 4.5Ah Rechargeable battery And AC/DC 12V 800mA adapter power;		
Battery life	90 hours typical. Battery Life is less when the backlight is used.		
Interface	RS-232 bi-directional Interface		
Display	6 digits, 40mm digit height LCD digital display with backlight		
Balance Housing	Indicator: IP 68 rated Stainless Steel Scale: Grade 304 stainless steel		
Overall dimension	870 x 476 x 205 mm		AGF 600: 1286 x 661 x 210mm
Net weight	18kg		AGF 600: 35kg
Functions	Weighing, Check weighing, Parts counting, Memory Accumulation, Animal weighing, Percent weighing, Peak hold		
Weighing units	Grams, Kilogram, pound, ounce, pound/ounce; Newton;		
Calibration	Automatic External		

### 3.0 INSTALLATION

#### 3.1 LOCATING THE SCALE

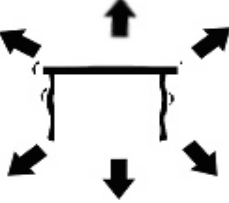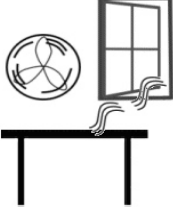
	<ul style="list-style-type: none"><li>• The scale should not be placed in a location that will reduce the accuracy.</li><li>• Avoid extremes of temperature. Do not place in direct sunlight or near air conditioning vents.</li></ul>
	<ul style="list-style-type: none"><li>• Avoid unsuitable tables or surfaces.</li></ul>
	<ul style="list-style-type: none"><li>• Avoid unstable power sources. Do not use near large users of electricity such as welding equipment or large motors.</li><li>• Do not place near vibrating machinery.</li><li>• Avoid air movement such as from fans or opening doors. Do not place near open windows or air-conditioning vents.</li></ul>
	<ul style="list-style-type: none"><li>• Keep the scale clean. Do not stack material on the indicator when not in use.</li></ul>



#### 3.2 LIST OF ACCESSORIES

Your packet contains-

- ✓ **AC adapter**
- ✓ **Indicator**
- ✓ **Wall mount bracket and mounting hardware**
- ✓ **Instruction manual**
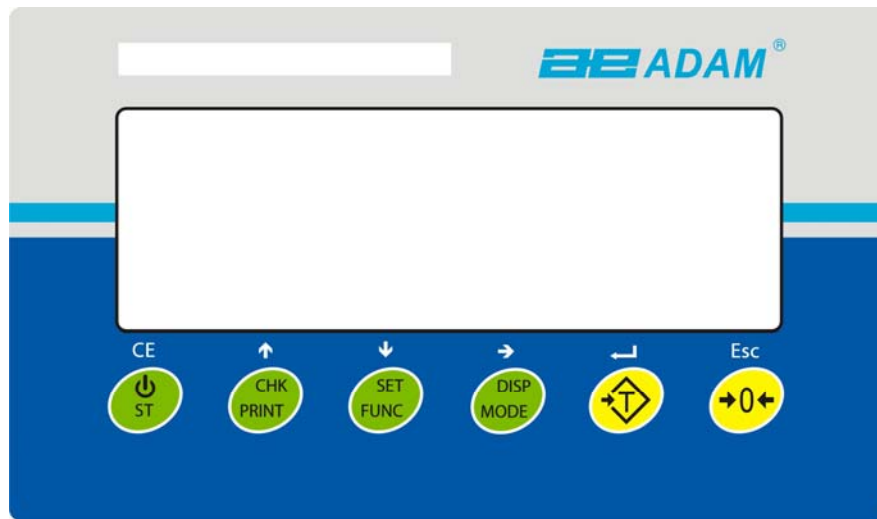
## 4.0 KEY DESCRIPTIONS




 <b>[Tare/↵]</b>	<p>Sets the zero point for all subsequent weighing. The display shows zero.</p> <p>Tares the scale. Stores the weight currently on the scale as tare value, subtracts the tare value from the gross weight and shows the results.</p> <p>A secondary function, ↵ is of “Enter” key used when setting up the value for the Parameters.</p>
<b>[CHK/PRINT/↑]</b>	<p>CHK: Selects checkweighing. Used to set the Low/High weight limits while checkweighing.</p> <p>PRINT: Sends the results to a PC or a Printer using the RS-232 interface. It also adds the value to the accumulation memory if the accumulation function is not automatic.</p> <p>↑: Up directional button for scrolling. Also used for incrementing the active digit when setting a value for Parameters.</p>
<b>[Disp/Mode/→]</b>	<p>Selects the weighing unit to be displayed from those which are enabled. See parameter S1 in section 7.4.</p> <p>A secondary function, → is to move the active/flashing digit to the right when setting values for Parameters.</p>
<b>[Func/Set/↓]</b>	<p>Selects the Functions of the scale. If the scale is weighing, it will select parts counting. If it is not in weighing mode, it will return the user to weighing.</p> <p>A secondary function (SET) will bring up the settings menu. Also used to set values used for parameters</p>
<b>[→0←/Esc]</b>	<p>Used to zero the scale.</p> <p>A secondary function (<b>ESC</b>) is to return to normal operation when the scale is in a Parameter setting mode.</p>
 <b>/ ST/ CE]</b>	<p>To switch on and switch off the scale.</p> <p>ST: Secondary function allows the user to store/ recall checkweighing limits.</p>



## 5.0 DISPLAYS

The LCD display will show a value and a unit to the right of the digits.

In addition the LED's above the display will show when a weight is below or above checkweighing limits.

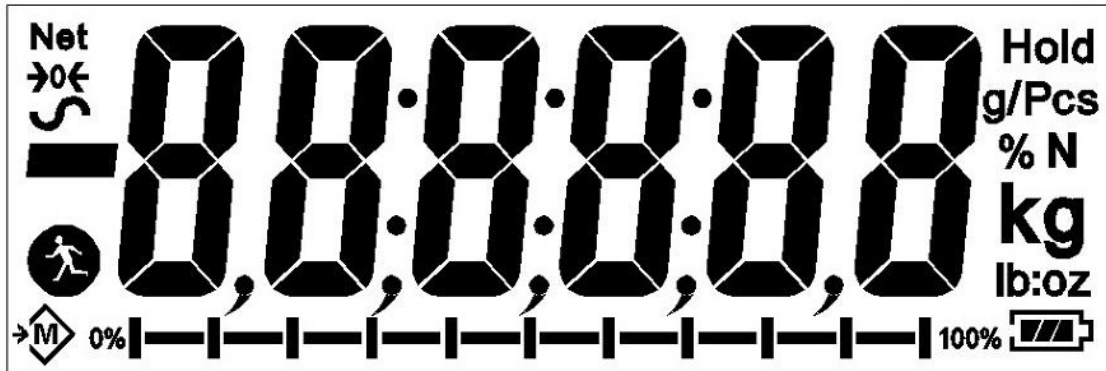


Other symbols will show when a weight has been tared (NET) the scale is at zero and stable, if a value has been stored in memory or when the animal weighing function has been enabled. A battery symbols will show the state of charge of the internal battery.

## 6.0 OPERATION

### 6.1 ZEROING THE DISPLAY


- You can press the **[→0←/Esc]** key at any time to set the zero point. This will usually be necessary when the platform is empty. You can only zero off a weight up to a maximum of 20% of the scale capacity. When the zero point is obtained the display will show an indicator for zero.

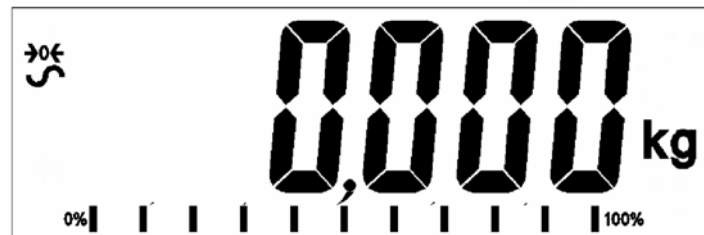


- The scale has an automatic re-zeroing function to account for minor drifting or accumulation of material on the platform. However you may need to press the **[→0←/Esc]** key to re-zero the indicator if small amounts of weight are shown when the platform is empty.

### 6.2 TARING

- Zero the scale by pressing the **[→0←/Esc]** key if necessary. The "ZERO" indicator will be ON. **→0←**

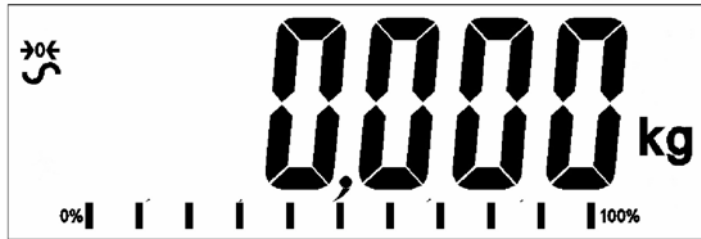


- Place a container onto a connected weighing scale platform, a value for its weight will be displayed.
- Press the **[Tare/⇩]** key to tare the scale. The weight that was displayed is stored as the tare value and that value is subtracted from the display, leaving zero on the display. The “**NET**” indicator will be ON. As a product is added only the net weight of the product will be shown. The scale could be tared a second time if another type of product was to be added to the first one. Again only the weight that is added after taring will be displayed.

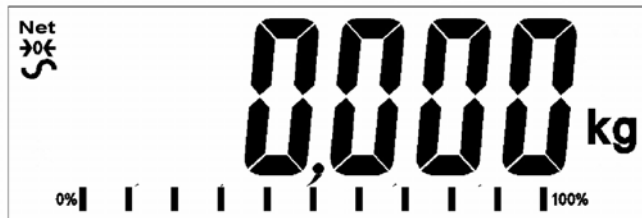

- When the container is removed a negative value will be shown. If the scale was tared just before removing the container this value is the gross weight of the container plus all products that was removed. The “**ZERO**” indicator will be on to indicate that the platform is back to the same condition as it was when zero was last set.
- To delete a Tare value, press **[→0←/Esc]** when the pan is empty.

### 6.3 WEIGHING A SAMPLE

To determine the weight of a sample, first tare the empty container if it is to be used and then place the sample in the container. The display will show the net weight of the sample and the units of weight currently in use.

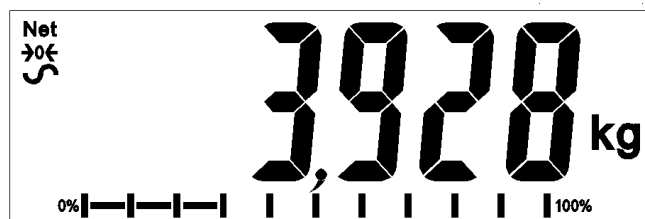

## 6.4 CHANGING THE WEIGHING UNITS

To change the weighing units, press the **[Unit/Mode]** key. Press the key again to move to the next unit type in the queue.

## 6.5 PRESET TARE

To preset a tare weight value, press and hold the **[Tare/↵]** key. The display will now show a flashing unit which can be increased or decreased using the ↑ or ↓ directional keys and the → directional key to move to the next digit.

Once you have set the desired sample size, press the **[Tare/↵]** key.

## 6.6 PARTS COUNTING

If parts counting is enabled, it is possible to count parts using a sample of the parts to determine average piece weight.

- Before starting, tare the weight of any container that may be used, leaving the empty container on the scale. Place a known number of samples in the container, if used. The number should match the options for parts counting, i.e., 10, 20, 50, 100 or 200 pieces.
- Press the **[Func/Set]** key to select the weighing mode.
- Using the directional buttons ↑ or ↓, scroll through to the parts counting mode, “**Count**” will be shown on the display. Press **[Tare/↵]** to confirm.
- Once in parts counting mode the “Pcs” indicator will appear on the right-hand side of the display. Place the sample onto the scale and press the **[Disp/Mode]** key.
- The display will now show a flashing unit which can be increased or decreased using the ↑ or ↓ directional keys. Once you have set the desired sample size, press the **[Tare/↵]** key.
- From here you will return to the main piece counting display which will show the number of pieces assigned to the weight on the scale. Adding or removing weight will cause the number of pieces to change in relation to the weight per piece.



- Press the **[Func/Set]** key to change the mode.

## 6.7 CHECK-WEIGHING

Check-weighing is a procedure to cause lamps to come on (and if enabled, an alarm to sound) when the weight on the scale meets or exceeds values stored in memory. The memory holds the last values for a high and a low limit when the power is turned off. The user can set either one limit or both as described below.

The limits can be set when the scale is in weighing or parts counting modes. After limits have been set the Check-weighing function is enabled.

When a weight is placed on the scale the LED's above the display will show if the weight is above or below the limits and the beeper will sound, if the beeper is enabled.

- Press the **[Func/Set]** key to select the weighing mode.
- Using the directional buttons ↑ or ↓, scroll through to the normal weighing mode, “**Weight**” will be shown on the display. Press **[Tare/←]** to confirm.
- Once in normal weighing mode, hold the **[CHK/PRINT]** button for 2-3 seconds. “**Hi**” will appear on the display followed by a value on the display with a flashing digit.
- To set the high limit, use the directional keys ↑ or ↓ to scroll between numbers 1-9 and the → directional key to move to the next digit. Press **[Tare/←]** to confirm.
- Once confirmed, “**Lo**” will appear on the display followed by a value on the display with a flashing digit.
- To set the low limit, follow the same process as before using the directional keys to scroll and **[Tare/←]** to confirm.
- Once confirmed you will return to the normal weighing screen. Placing an object onto the scale will now turn the indicator display red, yellow or green depending on whether the value is within, under or over the set weight limits.

For checkweighing in parts counting mode, use the directional buttons ↑ or ↓, scroll through to the parts counting mode, “**Count**” will be shown on the display. Press **[Tare/←]** to confirm and follow the same process as outlined above.

### 6.7.1 Relay outputs and checkweighing

The relay outputs are open collector drivers to control an external relay. The relays will be active when the corresponding LED is on during check-weighing. The ZERO relay output will be on when the scale is showing the display is at Zero.

BOTH LIMITS SET	The display backlight will be green when the weight is between the limits	CHK bP = In / out / off The beeper will sound when the weight is between the limits, i.e. OK  F3 bEP = bP OtL Beeper will sound if weight is outside the limits.
-----------------	---	--

<p>LOW LIMIT SET HIGH LIMIT is set to zero</p>	<p>The display will be amber when the weight is less than the Low Limit. Above the Low Limit the display backlight will be green,</p>	<p>CHK bP = In</p> <p>The beeper will be off when the weight is less than the Low Limit. Above the Low Limit the beeper will be on</p> <p>CHK bP = Out</p> <p>The beeper will be on sound when the weight is below the Low Limit</p>
<p>HIGH LIMIT SET LOW LIMIT is set to zero</p>	<p>The display will show a red backlight until High limit is reached, then green backlight above the High limit. Beeper will turn on after High limit.</p>	<p>CHK bP = In</p> <p>The beeper will be on when the weight is less than the High Limit. Above the High Limit the beeper will be off.</p> <p>CHK bP = Out</p> <p>When set to bP OtL the indicator alarm will turn on below the high limit with red backlight.</p> <p>The beeper will be off when the weight is below the High Limit, on when it is above the High limit.</p>
<p>BOTH LIMITS SET. LOW IS SET GREATER THAN HIGH</p>	<p>This condition is not allowed.</p>	

**NOTE:**  
Weight must be more than 20 scale divisions for check weighing to operate. Below 20 scale divisions the LED's will not light and the beeper will not be on.

The Check-weighing function can be set up during Weighing or Parts Counting by entering values as Low or/and High Limits keyed in by the user. The limits are displayed in **kg (or Lb)** or **pcs** respectively.



**Checkweighing during Parts Counting**

To disable the Check-Weighing function enter zero into both limits by pressing the **[Func/Set]** key when the current limits values are displayed during the setting procedure, then pressing **[Tare/↵]** to store the zero values.

The values set for the check-weighing will remain in memory when the weighing units or the function changes to parts counting but will not be active. The will become active again when the weighing unit or parts counting that was active at the time the limits were set is reactivated.

## 6.8 ACCUMULATED TOTAL

- The scale can be set to accumulate manually by pressing the **[CHK/ Print]** key or automatically when a weight is removed from the scale. The accumulation function is available when weighing or when counting parts. However the memory is cleared if the weighing units or functions are changed.
- When the weight (or count) displayed is stored in memory the display will show “ACC 1” and then the total in memory for 2 seconds before returning to weighing. The RS-232 interface will output to a printer or PC.
- Remove the weight, allowing the scale to return to zero and put a second weight on. When this value is stored, the display will show “ACC 2”, then the new total and finally the value of the second weight. Repeat as necessary to add all the values needed to the memory.
- To view the total in memory press the **[CHK/Print]** key when there is no weight on the scale. The display will show the number of entries and the total.
- To clear the memory (set the value to zero) press the **[Power/ST]** key during the time the totals are being displayed, “Clear” will flash on the display for 2-3 seconds and then return to the usual weighing display.

## 6.9 PERCENT WEIGHING

The scale can be set to perform percent weighing.

The scale will use a mass on the platform as the 100% reference weight.

- Press the **[Func/Set]** key to select the weighing mode.
- Using the directional buttons ↑ or ↓, scroll through to the parts counting mode, “Percent” will be shown on the display. Press **[Tare/↵]** to confirm.
- Once in percent weighing mode the “%” indicator will appear on the right-hand side of the display.



- Remove the sample weight. Then any other weight placed on the scale will be displayed as a percentage of the original sample. For example, if 3500g is placed on the scale and percent weighing is selected, the display will show 100.0%. Remove the 3500g weight and place a 3000g weight. The display will show 85.7% as 3000g is 85.7% of 3500g.



- The number of decimal points will depend on the weight used in comparison to the capacity of the system. A smaller weight will show only "100%" while a larger weight might show "100.00%".
- If the scale was showing zero weight when entering this function, then the user must manually enter the weight to be set as 100% as described below.
- Make reference weight of 100% on platform.
- Press the **[Disp/Mode]** key. Display will show 100%.
- The weight entered must be greater than 50 scale divisions.
- Press the **[Func/Set]** key to select a new weighing mode.

#### NOTE:

The display may jump by large numbers unexpectedly if small weights are used to set as 100% reference. The scale checks if the weight is too small and will show Error 7.

### 6.10 ANIMAL (DYNAMIC) WEIGHING

The scale can be set to animal (dynamic) weighing for weighing any items that are unstable or may move.

The scale will use a special filter to minimise the effects of any movement while the moving animal or unstable samples are on the scale.

- Press **[Func/Set]** and scroll through the list of functions using the ↑ and ↓ directional keys
- Press **[Tare/←]** to enter animal weighing. The display will show "LOAD" and the

Animal/Dynamic weighing symbol  The scale is now ready to weigh an unstable animal or sample on a weighing scale platform.

- To use the Animal Weighing function it is necessary to set the amount of filtering required for the item to be weighed. More active animals will require a higher level of filtering to give a stable result. Press the **[Disp/Mode]**. The display will show “Flt x” where x is a value from 1 to 5. The higher the value the greater the amount of filter will be. To increment the value shown press the **[↑]** key then press the **[Tare/↵]** key to accept it.

### 6.10.1 Animal weighing procedure

- With the weighing scale platform empty the indicator display will “**LOAD**”. Place containers or blankets onto the platform and press the **[→0←/Esc]** key to remove the weight of the containers or blankets, alternatively, a long press on the **[Tare/↵]** key, will retain the container or blanket value as “**NET**”.
- Place the animal or sample to be weighed on the platform.
- Press **[Tare/↵]** key to start to the measurement. The display will show the live measurements until a stable weight is determined. The time it takes for the stable value will depend upon the setting of the filter parameter in the first step.
- When a stable reading is found, the display will show this value, and the display will be locked until the **[→0←/Esc]** key is pressed. The display will show the “**Hold**” symbol while the display is locked.




- To weigh a second subject press the **[→0←/Esc]** key if necessary to zero the display, and place the next animal on the scale. The scale will detect the new weight and hold it as before.
- The scale will remain in the animal weighing mode until a new mode is selected using the **[Func/ Set]** key and **[Tare/↵]** key to enter.

### 6.11 ANIMAL 2 (DYNAMIC 2) WEIGHING

The scale can be set to animal 2 (dynamic) weighing for sequential weighing of several items that are unstable.

This function allows the user to load several moving items into the platform at once, the scale will take a measurement of all items included. The function will then ask the user to remove one of the items, and then it will automatically measure and printout the weight of the removed item. The function it will repeat this process until there are no items left, or the user stops the function.



- Press **[Func/Set]** and scroll through the list of functions using the ↑ and ↓ directional keys
- Press **[Tare/↵]** to enter animal 2 weighing. The display will show “**LOAD**” and the Animal/Dynamic weighing symbol . The scale is now ready to weigh an unstable animal or sample on a weighing scale platform.
- To use the Animal Weighing function it is necessary to set the amount of filtering required for the item to be weighed. More active animals will require a higher level of filtering to give a stable result. Press the **[Disp/Mode]**. The display will show “Fit x” where x is a value from 0 to 5. The higher the value the greater the amount of filter will be. To increment the value shown press the [↑] key then press the **[Tare/↵]** key to accept it.

### 6.11.1 Animal 2 weighing procedure

- With the weighing scale platform empty the indicator display will show “**LOAD**”. Place containers or blankets onto the platform and press the **[→0←/Esc]** key to remove the weight of the containers or blankets, alternatively, a long press on the **[Tare/↵]** key, will retain the container or blanket value as “**NET**”.
- Place the animals or sample to be weighed on the platform.
- Press **[Tare/↵]** key to start to the measurement. The display will show the live measurements until a stable weight is determined. The time it takes for the stable value will depend upon the setting of the filter parameter in the first step.
- When a stable reading is found, the display will show this value, and the display will be locked for 2 seconds. The display will show the “**Hold**” symbol while the display is locked.



- After the 2 seconds delay, the display will now show “**UNLOAD**”, Remove one of the Animal or items, and press **[Tare/↵]** key to calculate the weight of the removed animal or item. The display will show the live measurements again, until a stable weight is determined.
- When a stable reading is found, the display will show this value, and the display will be locked for 2 seconds. The display will show the “**Hold**” symbol while the display is locked.
- After the 2 seconds delay, the scale will automatically print out the result. If all the animals or items have been removed, the scale will restart the function and it will

show “**LOAD**”, otherwise the scale will continue to run the function and the display will show “**UNLOAD**”, and the function will continue to repeat the measurements and print outs until all the animals or items have been removed. The user can stop/restart the function at any time by pressing the [**→0←/Esc**] key.

- The scale will remain in the animal weighing mode until a new mode is selected using the [**Func/ Set**] key and [**Tare/←**] key to enter.

## 6.12 HOLD/ PEAK FUNCTION

- Press [**Func/Set**] and scroll through the list of functions using the ↑ and ↓ directional keys.
- Press [**Tare/←**] to enter ‘**Hold**’ or ‘**Peak**’ mode. Hold will allow the user to weigh an object and hold the value, whilst the Peak function will allow you to complete multiple weighings and record the peak value.
- Place the object to be weighed onto the weighing platform, “**hold**” will appear in the top-right corner of the display.
- Once the weight has stabilised, the weight value will remain on the display until either more weight is added onto the weighing pan or the weighing mode is changed.
- If using the “**Peak**” mode, the recorded “**Peak**” can be held for set interval, and after that the “**Peak**” will be deleted automatically if a higher “**Peak**” hasn’t been recorded, the “**Peak**” release time can be set by pressing the [**Unit/ Mode**] key and using the directional keys ↑ and ↓ to set the “**Peak**” delete time interval in seconds, or to turn this off [del 2s – del 10s, or OFF].
- If the “**Peak**” release is set to OFF, the [**→0←/Esc**] key can be used to clear the “**Peak**”, and restart the function.

## 7.0 USER PARAMETERS

Pressing the [**Func/Set**] key and holding for 2 seconds during normal operation allows the user to access the parameters for customising the scale. The parameters are split into 2 groups:

1. Scale parameters (pressing the [**Func/Set**] key will access this automatically).
2. RS-232 parameters (can be accessed by selecting the ‘**rs 1**’ and ‘**rs 2**’ menu options in the scale parameters menu).

## 7.1 SCALE PARAMETERS

- Pressing the **[Func/C]** key and holding for 2 seconds during normal operation allows the user to access the parameters.
- Scroll through the list of functions using the ↑ and ↓ directional keys. Press **[Tare/←]** to enter a parameter.
- Press **[→0←/Esc]** to exit the scale parameter section and return to normal weighing.

This group of parameters is used to control the operation of the scale.

Parameter	Description	Options	Default setting
<b>Time</b>	Set Time.	Enter the time manually.	00:00:00
<b>Date</b>	Set date format and settings. Format for date can be changed when the display shows mmddyy, ddmmyy or yymmdd by pressing the <b>[Pcs/□]</b> key, then enter the date.	Enter the date format and then the numeric value manually.	mm:dd:yy
<b>bL</b>	Backlight set to always on, always off or automatic on whenever a weight is placed or a key is pressed	oFF on AUTO	AUTO
<b>Power</b>	Disable or set time increment to turn off scale	0 1 2 5 10 15 Off	2
<b>Key bp</b>	Key beeper settings	On Off	On
<b>Chk bp</b>	Checkweighing beeper settings	In Out Off	In
<b>Unit</b>	Enable or disable weighing units, will not allow to disable all units, at least one has to be enabled. Parts counting can be enabled/disabled	Kg Grams lb oz lb:oz N (Newtons) PCS	Kg
<b>Auto-Z</b>	Auto zero settings	0.5 1 1.5 2 2.5 3	0.5
<b>Filter</b>	Filter setting to slow, normal or fast	Slower Slowest Faster	Faster

		Fastest Then: 1-6	
<b>Rs 1</b>	Brings up the 1 <sup>st</sup> RS232 menu. Includes PC, command and print settings	PC Cmd Print	
<b>Rs 2</b>	Brings up RS232 menu 2	PC Cmd	
<b>S-id</b>	Set Scale ID	To be entered manually	000000
<b>U-id</b>	Set User ID	To be entered manually	000000
<b>rechar</b>	Indicates time to recharge	-	-

## 7.2 RS-232 PARAMETERS

This group of parameters can be set by the user for setting the RS-232 active or not, baud rate, printing mode, accumulation mode, RS-232 language, and user or scale ID numbers.

- Pressing the **[Func/Set]** key and holding for 2 seconds during normal operation allows the user to access the parameters.
- Scroll through the list of functions using the ↑ and ↓ directional keys. Press **[Tare/↵]** to enter the ‘rs 1’ or ‘rs 2’ parameters when appearing on the display.
- ‘Rs 1’ will provide access to ‘Print’, ‘PC’ and ‘Cmd’ settings. ‘Rs 2’ includes ‘PC’ and ‘Cmd’ only. Press **[Tare/↵]** to confirm.
- When entering a mode, the user will be required to go through each step of the process by entering the desired values or selecting from the options listed in the table below and pressing the **[Tare/↵]** key to confirm.
- Press **[→0←/Esc]** to exit the scale parameter section and return to normal weighing.

### 7.2.1 Print settings

Parameter	Description	Options	Default Values or setting
[baud rate]	Baud Rate	1200 2400 4800 9600 19200 38400 57600 115200	9600
[Language]	Select Language	EnGLis (English) FrEnCH (French) GErmAn (German) SPAn (Spanish) <b>Portug</b> (Portuguese) <b>Itail</b> (Italian)	EnGLis
[Accumulation]	Enable or disable the Accumulation	on oFF	off
[Printing]	Printing Mode- Manual or	mAn,	mAn

[mode]	Automatic	AUto P	
[Printer/device]	Select the printer or device to print to	ATP LP50	ATP
[Number of copies]	Select the number of copies	Copy 1 Copy 2 Copy 3 Copy 4 Copy 5 Copy 6 Copy 7 Copy 8	Copy 1
[Print layout]	Select complex or simple print layout	Comp Simp	Comp
[Line break]	Select the number of line breaks between weight values on label.	1 Lfcr 2 Lfcr 3 Lfcr 4 Lfcr 5 Lfcr 6 Lfcr 7 Lfcr 8 Lfcr 9 Lfcr 10 Lfcr	1 Lfcr

Scale will perform the following, depending on the Accumulation and Print Settings:

	AC on	AC Off
	AUto	Accumulate and print automatically
mAn	Accumulate and Print only when <b>[Print/M+/Esc]</b> key pressed. If <b>[Print/M+/Esc]</b> is pressed a second time only print the weight.	Print when <b>[Print/M+/Esc]</b> key is pressed, Do not accumulate.

### 7.2.2 PC settings

Parameter	Description	Options	Default Values or setting
[baud rate]	Baud Rate	1200 2400 4800 9600 19200 38400 57600 115200	9600
[Model]	Select the scale/model	Adam	Adam

	being used.	CBK NBL	
[Interval]	Select the interval per second for sending data to a PC.	Int 0 (continuous) Int 0.5 Int 1 Int 2	Int 0

### 7.2.3 Command settings

Parameter	Description	Options	Default Values or setting
[baud rate]	Baud Rate	1200 2400 4800 9600 19200 38400 57600 115200	9600

## 8.0 BATTERY OPERATION

- The scales can be operated from the battery if desired. The battery life can be up to 90 hours depending on the load cells used and how the backlight is used.
- When the battery needs charging a symbol on the display will show less bars in the battery symbol. The battery should be charged when only the battery outline is on. Once the bars have been turned off the scale will still operate for a short time after which it will automatically switch off to protect the battery.
- To charge the battery, simply plug the adaptor into the mains power. The scale does not need to be turned on.
- The battery should be charged for 12 hours for full capacity.
- Near the display is an LED to indicate the status of battery charging. When the scale is plugged into the mains power the internal battery will be charged. If the LED is green the battery has a full charge. If it is Red the battery is nearly discharged and yellow indicates the battery is being charged.

## 9.0 RS-232 INTERFACE

The AGF floor scale is supplied with bi-directional RS-232 interface as standard. The scale when connected to a printer or computer outputs the weight with the selected weighing unit through the RS-232 interface.

Specifications:

RS-232 output of weighing data


ASCII code

9600 Baud (user selectable)

8 data bits

No Parity

RS-232 serial interface is a plug as figure 2 shows:

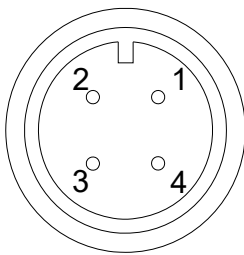

- 1: Pin GND, Signal Ground
- 2: Pin RXD, Received Data
- 3: Pin TXD, Transmitted Data

As viewed from the back of the indicator

The scale can be set to print text in English, French, German or Spanish. See the RS-232 parameters section for details.

### DATA FORMAT - COMPLETE WEIGHT

```
<cr><lf>
<cr><lf>
Date          12/09/2006 <cr><lf>
Time          14:56:27  <cr><lf>
<cr><lf>
Scale ID      123456   <cr><lf>           If ID is zero, it is left blank
User ID      234567   <cr><lf>
<cr><lf>
Net Wt       1.234 Kg <cr><lf>           Net Wt. (or Gross Wt.)
Tare Wt.     0.000kg
Gross Wt.    1.234 Kg
<cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
```

### Data Format-Parts Counting Output:

Weight, Unit weight and number of parts are printed.

```
<cr><lf>
<cr><lf>
Date          12/09/2006 <cr><lf>
Time          14:56:27  <cr><lf>
<cr><lf>
Scale ID      123456   <cr><lf>
User ID      234567   <cr><lf>
<cr><lf>
Net Wt.       1.234 Kg  <cr><lf>           Net Wt. (or Gross Wt.)
Unit Wt.      123 g    <cr><lf>           g for metric and lb for pounds
Pieces        10 pcs  <cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
```

### DATA FORMAT – HOLD

```
<cr><lf>
<cr><lf>
Date          12/09/2006 <cr><lf>
Time          14:56:27  <cr><lf>
<cr><lf>
Scale ID      123456   <cr><lf>
User ID      234567   <cr><lf>
<cr><lf>
Hold Wt.      1.000 Kg  <cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
```

### DATA FORMAT – PEAK HOLD

```
<cr><lf>
<cr><lf>
Date          12/09/2006 <cr><lf>
Time          14:56:27  <cr><lf>
<cr><lf>
Scale ID      123456   <cr><lf>
User ID      234567   <cr><lf>
<cr><lf>
Peak Holt Wt. 1.500 Kg  <cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
```



## DATA FORMAT – ANIMAL

```
<cr><lf>
<cr><lf>
Date          12/09/2006 <cr><lf>
Time          14:56:27  <cr><lf>
<cr><lf>
Scale ID      123456  <cr><lf>
User ID       234567  <cr><lf>
<cr><lf>
Animal Wt.    1.500 Kg  <cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
```

## DATA FORMAT – PERCENT

```
<cr><lf>
<cr><lf>
Date          12/09/2006 <cr><lf>
Time          14:56:27  <cr><lf>
<cr><lf>
Scale ID      123456  <cr><lf>
User ID       234567  <cr><lf>
<cr><lf>
Net Wt.       1.500 Kg  <cr><lf>
Ref Wt.       1000kg
Percent       150.00%
<cr><lf>
<cr><lf>
<cr><lf>
<cr><lf>
```

## DATA FORMAT – SIMPLE

```
<cr><lf>
<cr><lf>
Net Wt.       1.500 Kg  <cr><lf>
<cr><lf>
Hold Wt.      1000kg
Peak holt wt. 1000kg
Animal wt.    1000kg
Ref. wt.      1000kg
Percent       150.00%
<cr><lf>
Unit wt.      1.0234g
Pieces        1000     PCS
<cr><lf>
<cr><lf>
<cr><lf>
```

**DATA FORMAT- CONTINUOUS OUTPUT- NORMAL WEIGHING:**

ST,GROSS 1.234 Kg <cr><lf>	ST or US for STable or UnStable,
US,NET 0.000 Kg <cr><lf>	NET or GROSS for Net Weight or Gross wt. and the weighing unit, kg, lb etc.

**DATA FORMAT- CONTINUOUS OUTPUT- PARTS COUNTING:**

ST Net 1.234 Kg <cr><lf>	Net Weight (or Gross wt.)
U.W. 123 g <cr><lf>	Kg and g for metric and Lb for pounds
PCS 10 pcs <cr><lf>	
<cr><lf>	
<cr><lf>	

**NOTE:**

1. The accumulated total will not be sent to the RS-232 when the continuous print is turned on.
2. The continuous print will only be for the current weight and the display data.
3. In other languages the format is the same but the text will be in the language selected.

Description	ENGLISH	FRENCH	GERMAN	SPANISH
Net weight	Net Wt.	Pds Net	Net-Gew	Pso Net
Weight per unit counted	Unit Wt.	Pds unit	Gew/Einh	Pso/Unid
Number of items counted	Pcs	Pcs	Stck.	Piezas
Number of weighing added to subtotals	No.	Nb.	Anzhl	Num.
Total weight and count printed	Total	Total	Gesamt	Total
Print date	Date	Date	Datum	Fecha
Print time	Time	Heure	Zeit	Hora
Scale ID number	Scale ID	Bal ID	Waagen ID	Bal ID
User ID Number	User ID	Util ID	Nutzer ID	Usuario ID

## 9.1 INPUT COMMANDS FORMAT

The scale can be controlled with the following commands. Press the **[Enter]** key on the PC after each command.

<b>T&lt;cr&gt;&lt;lf&gt;</b>	Tares the scale to display the net weight. This is the same as pressing <b>[Tare/←]</b> .
<b>Z&lt;cr&gt;&lt;lf&gt;</b>	Sets the zero point for all subsequent weighing. The display shows zero.
<b>P&lt;cr&gt;&lt;lf&gt;</b>	Prints the results to a PC or printer using the RS-232 interface. It also adds the value to the accumulation memory if the accumulation function is not set to automatic.

## 10.0 CALIBRATION

The AGF scales calibrate using either metric or pound weights, depending on the weighing unit in use before calibration. The display will show either "kg" or "lb" to identify the weights expected.

The scale can be calibrated using the following procedure:

- Turn on the power and wait for the scale to configure.
- Before configuration is completed, hold down the **[Tare]** ← key to bring up the user password information screen.
- To enter the password, use the directional buttons ↑ or ↓ to scroll through numbers 1-9. Use the → directional key to move to the next digit.
- Entering the correct password **[1000]** will bring you to the user setup menu.
- Within the menu, use the directional buttons ↑ or ↓ to scroll through the settings until **'U-cal'** appears on the display. Press the **[Tare]** ← key to select.
- After pressing **[Tare]** ←, **'noload'** should appear on the display. Use the directional button ↑ to switch to **'load1'** and set the desired weight limit of the test object to be placed on the scale using the ↑ or ↓ directional buttons and the → directional key to move to the next digit. Press the **[Tare]** ← key to confirm.
- After pressing **[Tare]** ←, **'Load'** will appear on the display. Place the calibration test weight that matches the weight previously entered onto the scale weighing pan and press the **[Tare]** ← key to confirm.
- Pressing Tare should bring up the **'Load 2'** option on the display. Follow the same procedure as before by setting a new weight and adding the appropriate calibration weight and press the **[Tare]** ← key to confirm.
- Pressing **[Tare]** ← will reconfigure the scale and bring the user back to the regular weighing mode.

## 11.0 ERROR CODES

ERROR CODES	DESCRIPTION	SUGGESTIONS
--oL --	Over-range	Remove weight from the scale.  If the problem persists contact your dealer or Adam Equipment for assistance.
Err 1	Time Setting Error	Enter time using correct format and reasonable values. Format: hh:mm:ss
Err 2	Date Setting Error	Enter date using correct format and reasonable values. Format: yy:mm:dd
Err 4	Zero Setting Error	The scale was outside the normal zero setting range either when it was turned on or when the <b>[Zero]</b> key was pressed. Remove weight from the scale and try re-zeroing again. Use the <b>[Z/T]</b> key to set the display to zero value. If the problem persists contact your dealer or Adam Equipment for assistance.
Err 6	A/D out of range	The values from the A/D converter are outside the normal range. Remove the weight from the scale if overloaded. Make sure the pan is attached. Indicates the load cell or the electronics may be faulty. If the problem persists contact your dealer or Adam Equipment for assistance.
Err 9	Check weigh limits error	Shown if the low limit is set higher than the current high limit. Reset High limit or different low limit.
FAIL	Calibration error.	Improper calibration (should be within $\pm 10\%$ of the factory calibration). The old calibration data will be retained until the calibration process is complete. If the problem persists contact your dealer or Adam Equipment for assistance.

## 12.0 REPLACEMENT PARTS AND ACCESSORIES

If you need to order any spare parts and accessories, contact your supplier or Adam Equipment. A partial list of such items is as follows-

<ul style="list-style-type: none"> <li>• Power Supply Module</li> <li>• Replacement Battery</li> </ul>	<ul style="list-style-type: none"> <li>• Printer, etc.</li> </ul>
--	---

## 13.0 SERVICE INFORMATION

This manual covers the details of operation. If you have a problem with the scale that is not directly addressed by this manual then contact your supplier for assistance. In order to provide further assistance, the supplier will need the following information which should be kept ready:

<p><b><u>A. Details of your company</u></b></p> <p>Name of your company:          Contact person's name:          Contact telephone, e-mail, fax or any other methods:</p>											
<p><b><u>B. Details of the unit purchased</u></b></p> <p>(This part of information should always be available for any future correspondence. We suggest you to fill in this form as soon as the unit is received and keep a print-out in your record for ready reference.)</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 70%;"><b>Model name of the scale:</b></td> <td></td> </tr> <tr> <td><b>Serial number of the unit:</b></td> <td></td> </tr> <tr> <td><b>Software revision number</b> <b>(Displayed when power is first turned on):</b></td> <td></td> </tr> <tr> <td><b>Date of Purchase:</b></td> <td></td> </tr> <tr> <td><b>Name of the supplier and place:</b></td> <td></td> </tr> </table>		<b>Model name of the scale:</b>		<b>Serial number of the unit:</b>		<b>Software revision number</b> <b>(Displayed when power is first turned on):</b>		<b>Date of Purchase:</b>		<b>Name of the supplier and place:</b>	
<b>Model name of the scale:</b>											
<b>Serial number of the unit:</b>											
<b>Software revision number</b> <b>(Displayed when power is first turned on):</b>											
<b>Date of Purchase:</b>											
<b>Name of the supplier and place:</b>											
<p><b><u>C. Brief description of the problem</u></b></p> <p>Include any recent history of the unit. For example:</p> <ul style="list-style-type: none"> <li>-Has it been working since it's delivered</li> <li>-Has it been in contact with water</li> <li>-Damaged from a fire</li> <li>-Electrical Storms in the area</li> <li>-Dropped on the floor, etc.</li> </ul>											

## WARRANTY STATEMENT

Adam Equipment offers Limited Warranty (Parts and Labour) for any components that fail due to defects in materials or workmanship. Warranty starts from the date of delivery.

During the warranty period, should any repairs be necessary, the purchaser must inform its supplier or Adam Equipment Company. The company or its authorised Technician reserves the right to repair or replace the components at any of its workshops at no additional cost, depending on the severity of the problems. However, any freight involved in sending the faulty units or parts to the Service Centre should be borne by the purchaser.

The warranty will cease to operate if the equipment is not returned in the original packaging and with correct documentation for a claim to be processed. All claims are at the sole discretion of Adam Equipment.

This warranty does not cover equipment where defects or poor performance is due to misuse, accidental damage, exposure to radioactive or corrosive materials, negligence, faulty installation, unauthorised modifications or attempted repair, or failure to observe the requirements and recommendations as given in this User Manual.


This product may include a rechargeable battery that is designed to be removed and replaced by the user. Adam Equipment warrants that it will provide a replacement battery if the battery manifests a defect in materials or workmanship during the initial period of use of the product in which the battery is installed.

As with all batteries, the maximum capacity of any battery included in the product will decrease with time or use, and battery cycle life will vary depending on product model, configuration, features, use, and power management settings. A decrease in maximum battery capacity or battery cycle life is not a defect in materials or workmanship, and is not covered by this Limited Warranty.

Repairs carried out under the warranty do not extend the warranty period. Components removed during warranty repairs become company property.

The statutory rights of the purchaser are not affected by this warranty. The terms of this warranty is governed by the UK law. For complete details on Warranty Information, see the terms and conditions of sale available on our web-site.

## WEEE 2012/19/EU

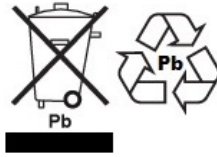

This device may not be disposed of in domestic waste. This also applies to countries outside the EU, per their specific requirements. Disposal of batteries (if fitted) must conform to local laws and restrictions.

Cet appareil ne peut être éliminé avec les déchets ménagers. L'élimination de la batterie doit être effectuée conformément aux lois et restrictions locales.

Dieses Gerät nicht mit dem Hausmüll entsorgt.

Dispositivo no puede ser desechado junto con los residuos domésticos

Dispositivo non può essere smaltito nei rifiuti domestici.

## FCC / IC CLASS A DIGITAL DEVICE EMC VERIFICATION STATEMENT

NOTE: This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC rules and Canadian ICES-003/NMB-003 regulation. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference in which case the user will be required to correct the interference at his own expense.

## CALIFORNIA PROPOSITION 65 - MANDATORY STATEMENT

WARNING: This product includes a sealed lead-acid battery which contains chemicals known to the State of California to cause cancer and birth defects or other reproductive harm.



Adam Equipment products have been tested with, and are always supplied with mains power adaptors which meet all legal requirements for the intended country or region of operation, including electrical safety, interference and energy efficiency. As we often update adaptor products to meet changing legislation it is not possible to refer to the exact model in this manual. Please contact us if you need specifications or safety information for your particular item. Do not attempt to connect or use an adaptor not supplied by us.

**ADAM EQUIPMENT** is an ISO 9001:2008 certified global company with more than 40 years' experience in the production and sale of electronic weighing equipment.

Adam products are predominantly designed for the Laboratory, Educational, Health and Fitness, Retail and Industrial Segments. The product range can be described as follows:

- Analytical and Precision Laboratory Balances
- Compact and Portable Balances
- High Capacity Balances
- Moisture analysers / balances
- Mechanical Scales
- Counting Scales
- Digital Weighing/Check-weighing Scales
- High performance Platform Scales
- Crane scales
- Mechanical and Digital Electronic Health and Fitness Scales
- Retail Scales for Price computing

For a complete listing of all Adam products visit our website at  
[www.adamequipment.com](http://www.adamequipment.com)

<p><b>Adam Equipment Co. Ltd.</b>  Maidstone Road, Kingston  Milton Keynes  MK10 0BD  UK  Phone: +44 (0)1908 274545  Fax: +44 (0)1908 641339  e-mail:  <a href="mailto:sales@adamequipment.co.uk">sales@adamequipment.co.uk</a></p>	<p><b>Adam Equipment Inc.</b>  1, Fox Hollow Rd.  06478  USA  Phone: +1 203 790 4774  Fax: +1 203 792 3406  e-mail:  <a href="mailto:sales@adamequipment.com">sales@adamequipment.com</a></p>	<p><b>AE Adam GmbH.</b>  Instenkamp 4  D-24242 Felde  Germany  Phone +49 (0)4340 40300 0  Fax: +49 (0)4340 40300 20  e-mail:  <a href="mailto:sales@adamequipment.co.za">sales@adamequipment.co.za</a></p>
<p><b>Adam Equipment S.A. (Pty) Ltd.</b>  7 Megawatt Road,  Spartan EXT 22  Kempton Park,  Johannesburg,  Republic of South Africa  Phone +27 (0)11 974 9745  Fax: +27 (0)11 392 2587  e-mail:  <a href="mailto:sales@adamequipment.co.za">sales@adamequipment.co.za</a></p>	<p><b>Adam Equipment (S.E. ASIA) PTY Ltd</b>  70 Miguel Road  Bibra Lake  Perth  WA 6163  Australia  Phone: +61 (0) 8 6461 6236  Fax +61 (0) 8 9456 4462  e-mail:  <a href="mailto:sales@adamequipment.com.au">sales@adamequipment.com.au</a></p>	<p><b>Adam Equipment (Wuhan) Co. Ltd.</b>  A Building East Jianhua  Private Industrial Park  Zhuanyang Avenue  Wuhan Economic &amp; Technological  Development Zone  430056 Wuhan  P.R.China  Phone: + 86 (27) 59420391  Fax + 86 (27) 59420388  e-mail:  <a href="mailto:info@adamequipment.com.cn">info@adamequipment.com.cn</a></p>

© Copyright by Adam Equipment Co. All rights reserved. No part of this publication may be reprinted or translated in any form or by any means without the prior permission of Adam Equipment.

Adam Equipment reserves the right to make changes to the technology, features, specifications and design of the equipment without notice.

All information contained within this publication is to the best of our knowledge timely, complete and accurate when issued. However, we are not responsible for misinterpretations which may result from the reading of this material.

The latest version of this publication can be found on our Website.

[www.adamequipment.com](http://www.adamequipment.com)